

SERVICE REPORT

ERB Basingstoke

SR NUMBER: 5009816833 324908735		FAA: XYWY939L	EASA: UK.145.00879
PO: 6852055	CUSTOMER PART NUMBER:	CONTRACT NUMBER:	
DATE REJECTED: 27.05.2016	DATE RECEIVED: 27.05.2016	DATE COMPLETED: 12.08.2016	
A/C TYPE: BAE 146 - AVRO RJ 85	A/C TAIL NUMBER: ZS-TC0	A/C SERIAL NUMBER: HS2388	
PACKING STATUS: No	SEALS INTACT: Intact	PHYSICAL DAMAGE: No	

REASON FOR REMOVAL:
 JETSPARES UNIT. FAULT: TRP FAIL

PART NUMBER	AS RECEIVED:	AS RELEASED:
	4068251-902	4068251-902
DESCRIPTION:	TRP BAE	TRP BAE
SERIAL NUMBER	94100042	94100042
UID(MFR/SPL SER/UCN PNO)		
HW MOD STATUS:	A.	A.
SW MOD STATUS:		
SOFTWARE LOAD:		

REASON FOR REMOVAL CONFIRMED: Rejection Confirmed	ESTIMATE SUPPLIED: No
PRIMARY SHOP FINDING: Hardware Fault Found	WARRANTY:
TYPE OF SERVICE:	TECHNICIAN: Ken Gerrish

MAINTENANCE STATEMENT:
 PAGES DETAILING WORK PERFORMED, ALONG WITH MATERIALS USED, ARE ATTACHED IN PAGES 2 THROUGH 3

SIGNATURE BELOW REQUIRED ONLY WHEN RETURN TO SERVICE IS NOT ISSUED: DATE: _____

SIGNATURE OF AUTHORIZED PERSON: _____

Complied With
 CMM/Eng Documentation: 22-55-03/Rev 3/Rev Date 01.10.1996;
 Service Bulletins:
 Customer Manuals/Documentation:

SHOULD YOU REQUIRE ANY FURTHER INFORMATION REGARDING THIS SERVICE REPORT, OR HAVE ANY QUESTIONS, PLEASE CONTACT OUR CUSTOMER RESPONSE CENTER AT 1-800-601-3099 OR VISIT OUR CUSTOMER PORTAL AT www.MyAerospace.com TO SUBMIT AN INQUIRY.

SERVICE REPORT

ERB Basingstoke

SR NUMBER: 5009816833		FAA: XYWY939L	EASA: UK.145.00879
PO: 6852055	CUSTOMER PART NUMBER:	CONTRACT NUMBER:	

Previously Complied With
 CMM/Eng Documentation:
 Service Bulletins:
 Customer Manuals/Documentation:

Comments:
 CUSTOMER FAULT CONFIRMED
 CLIMB AND MSTR MODE SWITCHES DEFECTIVE.
 A1-A4 CCA FOUND TO HAVE CONTACT PIN LUBRICATE ON CCA AROUND CONNECTOR TERMINALS
 NEW MSTR MODE SWITCH FITTED.
 NEW MODE SWITCH FITTED.
 ALL REMAINING MODE SWITCH LAMPS REPLACED MTBF.
 A1 -A4 CCA CLEANED AND REMORKED TO SPEC.
 UNIT REPAIRED, NEW PARTS FITTED AS LISTED
 UNIT CALIBRATED AND INSPECTED TO SPEC.
 ATEC ATE FINAL TEST TO SPEC.

DISPOSITION	REF DSG	P/N Installed	S/N Installed	P/N Removed	S/N Removed	Qty	SB
Replace	FIG 6-60	4069123-4		4069123-4		1.000	

CLIMB MODE SWITCH (S3) LENS WORN, REPLACED.

Replace	FIG 6-20B	4069123-1		4069123-1		1.000	
---------	-----------	-----------	--	-----------	--	-------	--

MSTER MODE SWITCH (S5) LENS WORN, REPLACED.

Replace	FIG 6-62	4059850-3		4059850-3		4.000	
---------	----------	-----------	--	-----------	--	-------	--

OLD/NEW TYPE LAMPS FITTED TO MODE SWITCH S2, LAMPS REPLACED.

Replace	FIG 6-62	4059850-3		4059850-3		4.000	
---------	----------	-----------	--	-----------	--	-------	--


TOGA MODE SWITCH LAMPS INCOMPLETE, REPLACED.

MEASUREMENT DESCRIPTION	MEAS. VALUE (DECIMAL)	MEAS. VALUE (HH:MM)

SERVICE REPORT

ERB Basingstoke

Honeywell Aerospace UK
Honeywell Aerospace Basingstoke
Edison Road
BASINGSTOKE, HAMPSHIRE
RG21 6QD
+44(0)1256 722200 (T) +44(0)1256 722201 (F)

SR NUMBER: 5009816833		FAA: XYWY939L	EASA: UK.145.00879
PO: 6852055	CUSTOMER PART NUMBER:	CONTRACT NUMBER:	
MEASUREMENT DESCRIPTION	MEAS. VALUE (DECIMAL)	MEAS. VALUE (HH:MM)	
CYCLES SINCE REPAIR			
TIME SINCE REPAIR		0:00	
			
RTS TECHNICIAN <u> <i>K.V. Lewis</i> </u>		DATE <u>12 AUG 2016</u>	